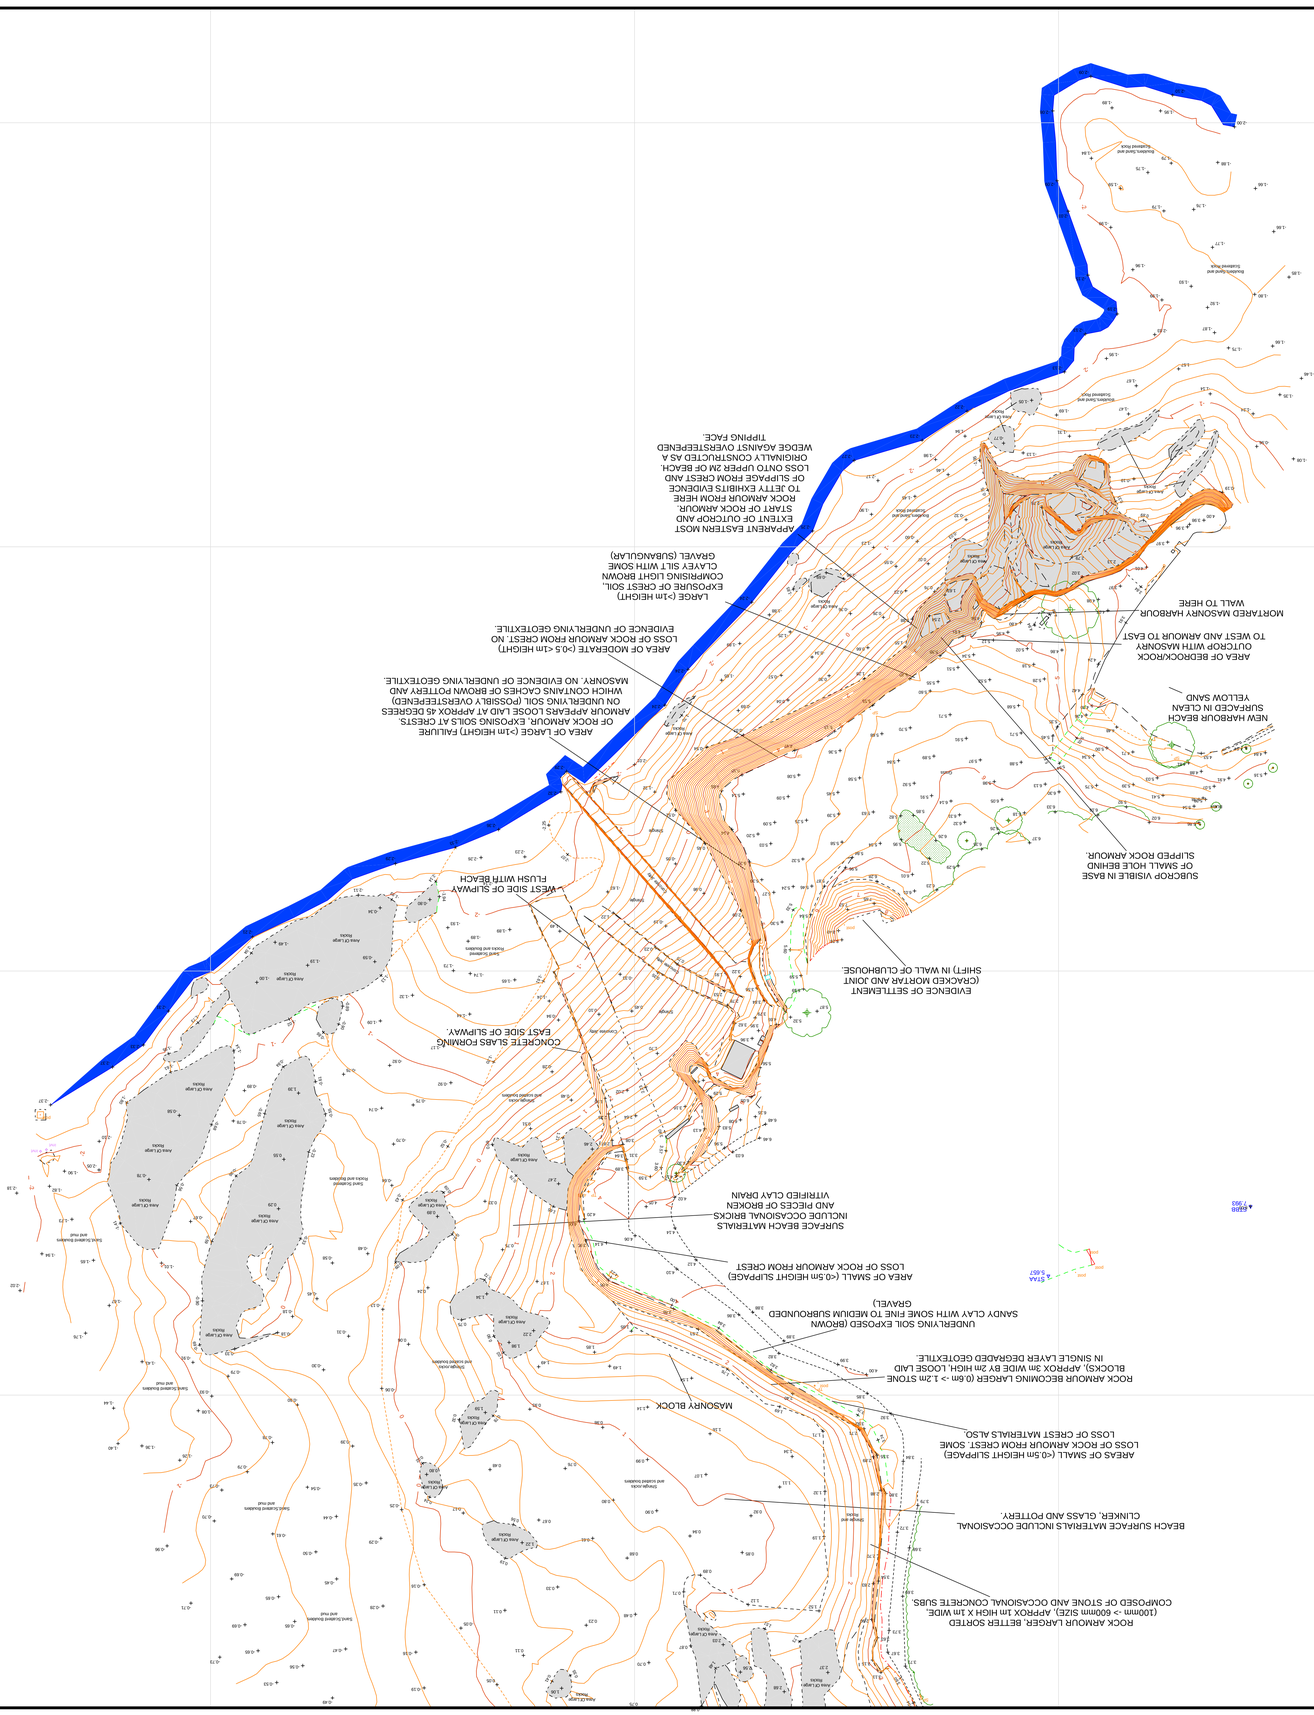
ROCK ARMOUR LARGER. BETTER SORTED (100mm -> 600mm SIZE). APPROX 1m HIGH X 1m WIDE. COMPOSED OF STONE AND OCCASIONAL CONCRETE SUBS.
BEACH SURFACE MATERIALS INCLUDE OCCASIONAL CLINKER, GLASS AND POTTERY.
AREAS OF SMALL (<0.5m HEIGHT SLIPPAGE) LOSS OF ROCK ARMOUR FROM CREST. SOME LOSS OF CREST MATERIALS ALSO.
MASONRY BLOCK
ROCK ARMOUR BECOMING LARGER (0.6m -> 1.2m STONE BLOCKS). APPROX 3m WIDE BY 2m HIGH, LOOSE LAID IN SINGLE LAYER DEGRADED GEOTEXTILE.
UNDERLYING SOIL EXPOSED (BROWN SANDY CLAY WITH SOME FINE TO MEDIUM SUBROUNDED GRAVEL)
AREA OF SMALL (<0 5m HEIGHT SLIPPAGE) LOSS OF ROCK ARMOUR FROM CREST
SURFACE BEACH MATERIALS INCLUDE OCCASIONAL BRICKS AND PIECES OF BROKEN VITRIFIED CLAY DRAIN
CONCRETE SLABS FORMING EAST SIDE OF SLIPWAY.
EVIDENCE OF SETTLEMENT (CRACKED MORTAR AND JOINT SHIFT) IN WALL OF CLUBHOUSE
SUBCROP VISIBLE IN BASE OF SMALL HOLE BEHIND SLIPPED ROCK ARMOUR.
WEST SIDE OF SLIPWAY FLUSH WITH BEACH
APPARENT EASTERN MOST EXTENT OF OUTCROP AND START OF ROCK ARMOUR. ROCK ARMOUR FROM HERE TO JETTY EXHIBITS EVIDENCE OF SLIPPAGE FROM CREST AND ORIGINALLY CONSTRUCTED AS A LOSS ONTO UPPER 2M OF BEACH, WEDGE AGAINST VOERSTEEPENED TIPPING FACE.
LARGE (>1m HEIGHT) EXPOSURE OF CREST SOIL. COMPRISING LIGHT BROWN CLAYEY SILT WITH SOME GRAVEL (SUBANGULAR)
AREA OF MODERATE (>0.5 <1m HEIGHT) LOSS OF ROCK ARMOUR FROM CREST. NO EVIDENCE OF UNDERLYING GEOTEXTILE.
AREA OF LARGE (>1m HEIGHT) FAILURE OF ROCK ARMOUR. EXPOSING SOILS AT CRESTS. ARMOUR APPEARS LOOSE LAID AT APPROX 45 DEGREES ON UNDERLYING SOIL (POSSIBLY OVERSTEEPENED) WHICH CONTAINS CACHES OF BROWN POTTERY AND MASONRY. NO EVIDENCE OF UNDERLYING GEOTEXTILE.
AREA OF BEDROCK/ROCK OUTCROP WITH MASONRY TO WEST AND ARMOUR TO EAST
NEW HARBOUR BEACH SURFACED IN CLEAN YELLOW SAND
MORTARED MASONRY HARBOUR WALL TO HERE
Boulders Lined and Scattered Rock
Boulders Lined and Scattered Rock
Boulders Lined and Scattered Rock
Area Of Large Rocks
Area Of Large Rocks
Area Of Large Rocks